



UNIVERSAL BELTING RESOURCE

"Working Through Distribution"


2 Paisley Park
 Carmichaels PA 15320
 800-928-9995
 customers@ubelting.com
 www.universalbelting.com

This sheet is a guideline only. Every press is a little different. We recommend that you do a test splice with your press before attempting the actual belt splice.

140200

0/2EC-0 PET/COTTON BARE WHITE

Splice (options)	Pressure (psi)	Temperature		Press Time	Foil (position)	Foil (type)	Skive Length (inch)
		TOP	BOTTOM				
Finger over Finger - Water Cooled	25	170° C 338° F	170° C 338° F	2 minutes	N/A	No Foil	N/A
Lap Splice	25	170° C 338° F	170° C 338° F	2 minutes	N/A	No Foil	N/A
Finger Splice - Carbon Fiber High Speed	15	165° C 329° F	165° C 329° F	1 minutes	N/A	No Foil	N/A
Mechanical Lace		# 36 (Clipper)					
Note:							
Recommended Joining Procedure: Finger over finger							

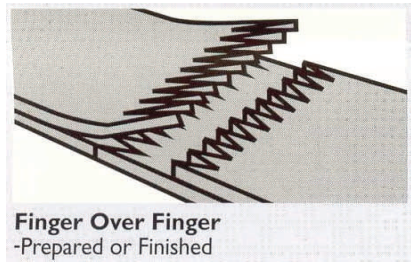

Finger Over Finger
 -Prepared or Finished