



UNIVERSAL BELTING RESOURCE

"Working Through Distribution"


2 Paisley Park
 Carmichaels PA 15320
 800-928-9995
 customers@ubelting.com
 www.universalbelting.com

This sheet is a guideline only. Every press is a little different. We recommend that you do a test splice with your press before attempting the actual belt splice.

261200

V35 XH/2E AS GRAY LR

Splice (options)	Pressure (psi)	Temperature		Press Time	Foil (position)	Foil (type)	Skive Length (inch)
		TOP	BOTTOM				
Finger over Finger	40	170° C 338° F	170° C 338° F	2 minutes	Top	PVC	N/A
Finger Splice	40	170° C 338° F	170° C 338° F	2 minutes	Top	PVC	N/A
Step Splice	40	170° C 338° F	170° C 338° F	2 minutes	Top	PVC	N/A
Mechanical Lace	# 36 SP (Clipper)						
	# 1 (Alligator)						
Note: Impression pad top - one ply silicone bottom							
Recommended Joining Procedure: Finger over Finger							

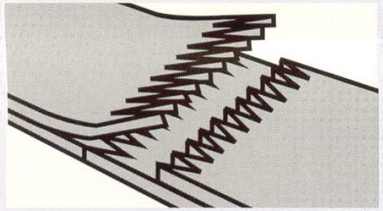

Finger Over Finger
 -Prepared or Finished