



UNIVERSAL BELTING RESOURCE

"Working Through Distribution"


2 Paisley Park
 Carmichaels PA 15320
 800-928-9995
 customers@ubelting.com
 www.universalbelting.com

This sheet is a guideline only. Every press is a little different. We recommend that you do a test splice with your press before attempting the actual belt splice.

110300

U0/2ES WHITE RIB

Splice (options)	Pressure (psi)	Temperature		Press Time	Foil (position)	Foil (type)	Skive Length (inch)
		TOP	BOTTOM				
Finger Splice - Water Cooled	20	155° C 311° F	155° C 311° F	60 seconds	Bottom	PU Foil	N/A
Finger Splice - Carbon Fiber High Speed Press	15	155° C 311° F	155° C 311° F	45 seconds	Bottom	PU Foil	N/A
Mechanical Lace		# 36 UCM XSP (Clipper)					
		# 00 (Alligator)					
Note: Rough Teflon bottom / silicone or matt release paper on top							
Recommended Joining Procedure: Finger Splice							

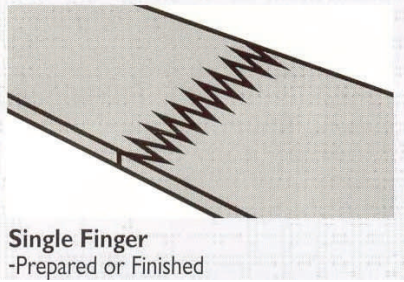

Single Finger
 -Prepared or Finished