



**UNIVERSAL BELTING RESOURCE**

"Working Through Distribution"


# 2 Paisley Park  
 Carmichaels PA 15320  
 800-928-9995  
 customers@ubelting.com  
 www.universalbelting.com

This sheet is a guideline only. Every press is a little different. We recommend that you do a test splice with your press before attempting the actual belt splice.

**140100**

**0/2C-0 COTTON FINE**

Splice (options)	Pressure (psi)	Temperature		Press Time	Foil (position)	Foil (type)	Skive Length (inch)
		TOP	BOTTOM				
Finger Splice - Water Cooled	20	165° C 329° F	165° C 329° F	1 minute	Bottom	PU Foil	N/A
Finger Splice - Carbon Fiber High Speed	15	165° C 329° F	165° C 329° F	30 seconds	Bottom	PU Foil	N/A
Mechanical Lace		# 36 XSP (Clipper)					
Note: Coarse PTFE on bottom/silicone pad on top							
Recommended Joining Procedure: 80mm Finger							

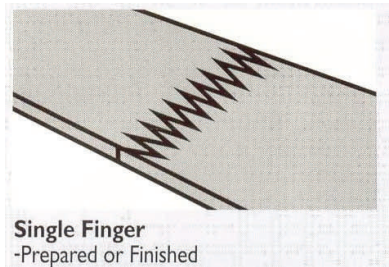

Single Finger  
 -Prepared or Finished